


2015 JCB 300T

UNIT: GE0300TVCF2197581

[Download Reconditioning Printout](#)





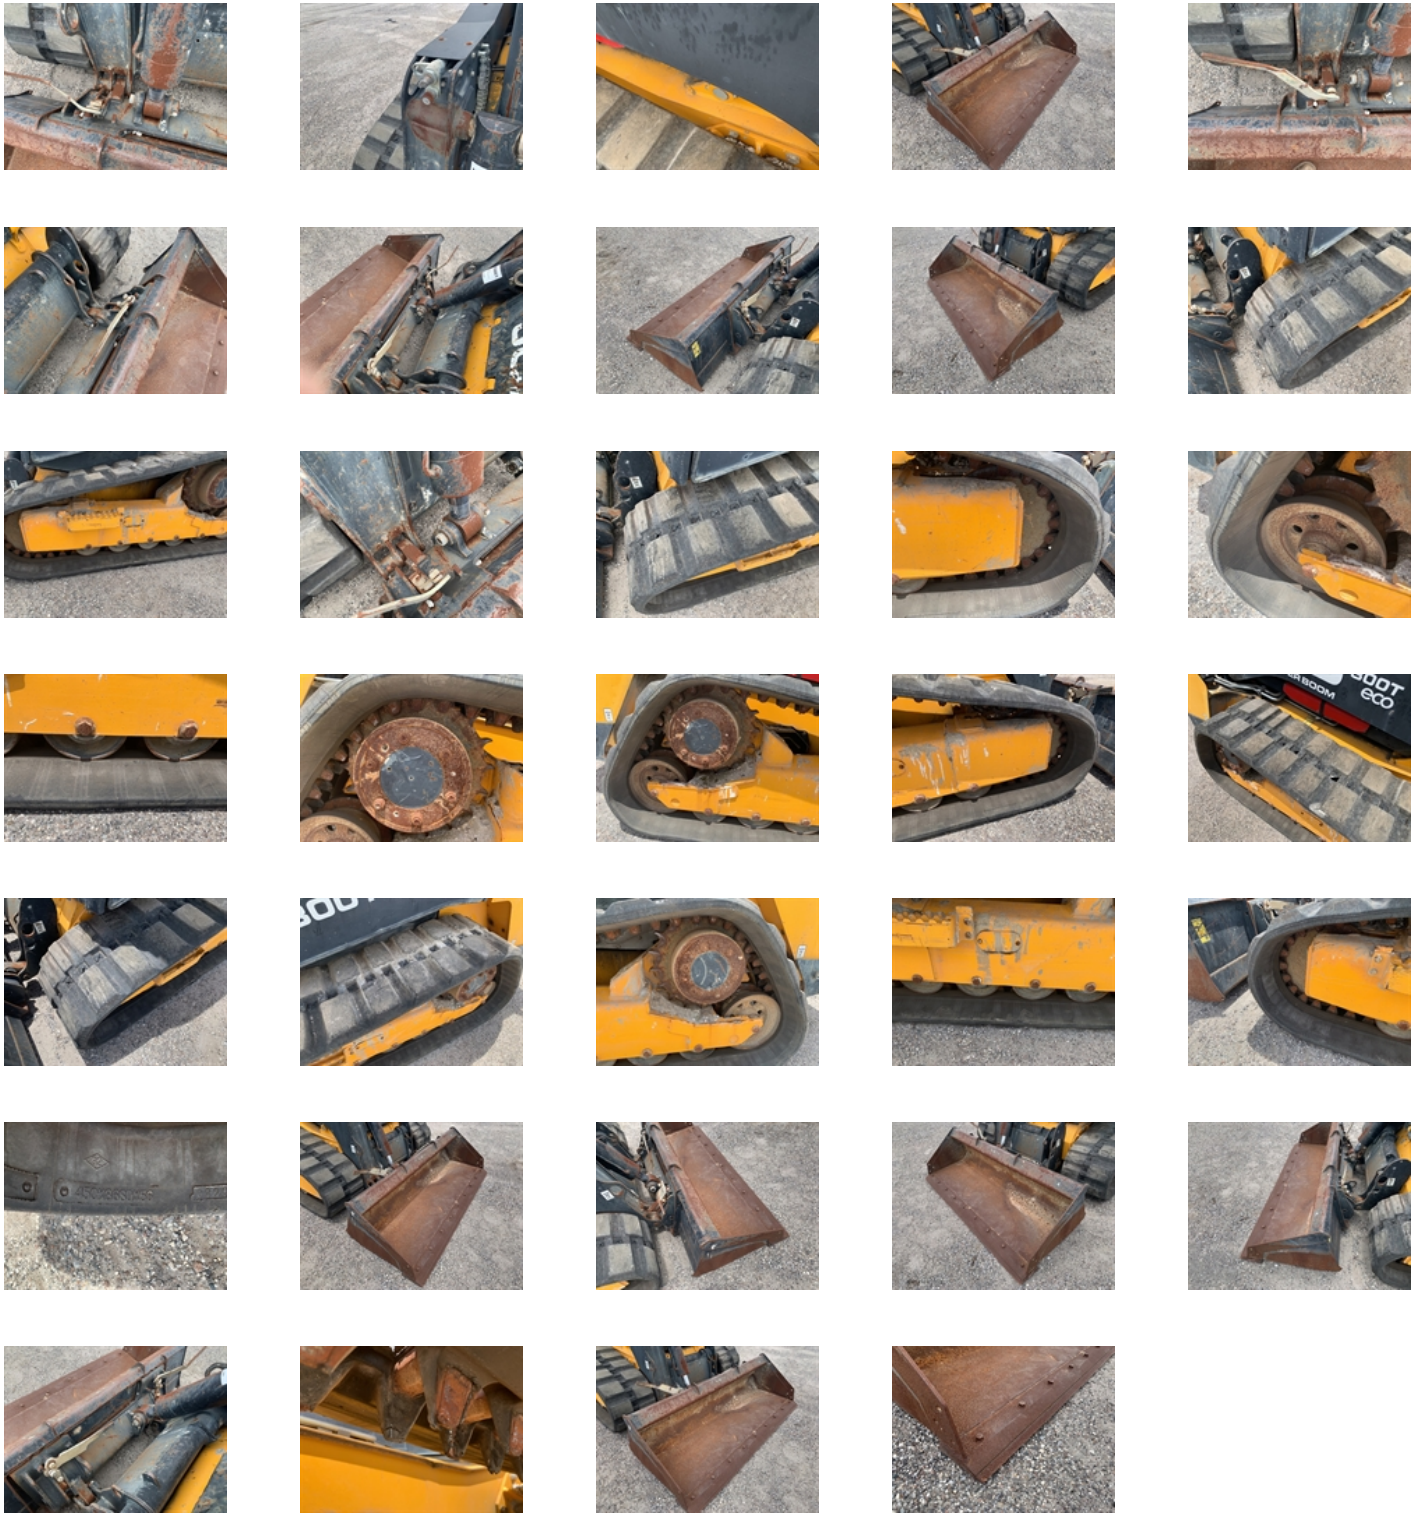

UNIT SPECS

Customer

Wells Fargo (IMS)

LOCATION

Wells Fargo (IMS)



Please call Pickup Support for location information

GENERAL APPEARANCE

Serial Number / VIN GE0300TVCF2197581

Pre-Operational Checks

Confirm Fluids Checked: Engine Coolant. Confirm Fluids Checked: Engine(s) Oil. Confirm Fluids Checked: Hydraulic Fluid. Confirm Fluids Checked: Fuel Level. N/A: Transmission Fluid

Paint Corrosion on boom and boom cylinder

Sheet Metal (Fiberglass) Condition

Rear engine cover damaged, Front of cab body damage

Cab/Canopy Overhead Structural Framework
No visible damage, Some paint peeling and showing corrosion

Cab Glass Condition

No visible damage or missing components

Steps/Ladders

No visible damage or missing components

Hand Rails No visible damage or missing components **Exterior Lights** Lights not working, missing rear light

FEATURES

Features Open Operator Station, Joystick Steering

SAFETY

Travel Alarm Operational

Horn Inoperable

Seat Belts Operational

Current Safety Manual No

Current Operator/Maintenance Manual No

CONTROL STATION

Seats/Armrests
No visible damage or missing components

Hydraulic Controls Rating Good

Drivetrain Controls Switch missing trim piece

Drivetrain Controls Rating Good **Oil Pressure**

The gauge registers in the operating range.

Warning Lights Operational

Gauges Operational

Hour Meter/Odometer (Start) 2163.6 hrs

Hour Meter/Odometer
2163.7 hrs, Operational hour meter

Limited Function Check

The main chassis components were operational in a limited check.

ENGINE

Blow by @ idle (subjective visual observation) No noticeable vapor or pressure

Starter Operational

Exhaust System No visible damage or missing components

Radiator Rating Good **Oil Leaks** No dripping leaks

Fuel Leaks No dripping leaks **Cooling System Leaks** No dripping leaks

Limited Function Check (Engine)

The engine started but did not run smoothly. Engine idles down and up

DRIVETRAIN

Drive Motors Rating Good **Limited Function Check** The drivetrain was operational.

HYDRAULICS

Pumps (Hydraulics) Rating Good **Valves Rating** Good

Hydraulic Tank Rating Good **Hoses (Hydraulics) Rating** Good

Auxiliary Hydraulic Plumbing Not operationally checked **Loader Lift Cylinders** Dripping leak on the right cylinder

Loader Lift Cylinders Rating Fair

Bucket Tilt Cylinders Rating Good **Limited Function Check (Hydraulics)** The hydraulic system was operational.

CHASSIS

Frame Condition Rating Good **Belly pans Rating** Good

Tire Brands 17.5 in Track Belts **Lift Arm Condition Rating** Good

Chassis to Arm Pins Rating Good **Quick Coupler to Arms Pins Rating** Good

Limited Function Check

The main components are in place and operational as noted.

UNDERCARRIAGE

Roller Frames Rating Good **Grouser Height Left**

Left side: 25 mm, Right side: 25 mm

Track Belt Condition No visible damage

Rubber Belt Drive Lugs Condition No visible damage

Track Tensioner Condition Operational

SPECIALTY

Quick Coupler Condition
Manual coupler right side not fully functional

Quick Coupler Rating Fair

Loader Bucket Condition Heavy wear

Loader Bucket Condition Rating

Fair **Loader Bucket Cutting Edge/Shanks/Teeth**
Heavy wear

Loader Bucket Cutting Edge/Shanks/Teeth Rating Fair

Backhoe Attachment Condition
Front Attachment Details, Quick Coupler Type: Manual Coupler, 78 in Bucket Type: Bucket

Other Attachment Rating Good

RECONDITIONING

Paint - Corroded/Peeling \$5,000



Body Panels - Rear Engine Cover Damaged \$750



Front of Cab Body Damaged

\$1,250



Exterior Lights - Lights Inop

\$800



Rear Light Missing

\$200



Horn - Inop

\$200

Drivetrain Controls - Switch Trim Missing

\$250



Engine Limited Function Check - Runs Rough, Idles Up and Down

\$2,500

Loader Lift Cylinders - Right Cylinder Leaking

\$950



Quick Coupler - Right Side Manual Coupler Not Fully Functional

\$400



Loader Bucket Condition - Worn

\$300



Loader Bucket Cutting Edge/Shanks/Teeth - Worn

\$200



Total

\$12,800