


2017 ROADTEC RX600E

UNIT: RX600E-3-4073

 [Download Reconditioning Printout](#)



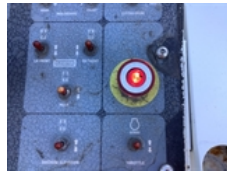






UNIT SPECS

Customer Wells Fargo (IMS)

LOCATION

Wells Fargo - USA 
275 Route 32
North Franklin, CT 06254

GENERAL APPEARANCE

UID RX600E-3-4073

Pre-Operational Checks

Confirm Fluids Checked: Engine Coolant. Confirm Fluids Checked: Engine(s) Oil. Confirm Fluids Checked: Hydraulic Fluid. Confirm Fluids Checked: Fuel Level. N/A: Transmission Fluid

Model RX600E

Lights Not operational

SAFETY

Travel Alarm Inoperable

Horn Operational

Safety Lock Out/Stop Operational

Current Operator/Maintenance Manual No

Current Safety Manual No

CONTROL STATION

Steering Control	Good	Hydraulic Controls	Good
Auxiliary Hydraulic Control Rating	Good	Drivetrain Controls	Good
Dash/Console	Good	Engine Oil Pressure	The gauge registers in the operating range.
Warning Lights	Operational	Gauges	Operational
Hour Meter/Odometer (Start)	3352 hrs	Hour Meter/Odometer	3353 hrs, Operational hour meter

Limited Function Check (Control Station)
The main components are in place and operational as noted.

ENGINE

Emission Certification Label	2017 US EPA Label, Requires Diesel Exhaust Fluid	Blow By	No noticeable vapor or pressure
		Starter	Operational
Radiator	Good	Oil Leaks	No dripping leaks
Fuel Leaks	No dripping leaks	Cooling System Leaks	No dripping leaks

Limited Function Check (Engine)
The engine started and ran.

CHASSIS

Chassis	6 ft Cutting Width, 12 in Milling Depth, Water System, 32 in Discharge Conveyor, Air Compressor	Transmission Type	Hydrostatic Drive
		Drive Motors	Good
Final Drives	Good	Limited Function Check (Drivetrain-Track) The drivetrain was operational as noted., The unit traveled initially however the parking brake circuit no longer operates and unit will not move.	
Rotor Shaft Bearings	Good	Limited Function Check (Chassis) The main chassis components functioned., Cutting head was not operated during inspection	
Main Frame Condition	Good	Track Frame	Good
Holders And Cutting Bits	Good	Conveyor Frame	Good
Conveyor Rollers Rating	Good	Collecting Conveyor	32" Conveyor
Discharge Conveyor	Good	Water Tank Condition	Not operationally checked
Water System	Not operationally checked	Air Compressor	Operational

Air Compressor Rating

Good **Limited Function Check (Cold Planer)**

The main components functioned with minor wear throughout.

HYDRAULICS

Pumps (Hydraulics)	Good	Hydraulic Motors	Good
Valves	Good	Hydraulic Tank	Seepage
Hydraulic Tank Rating	Good	Cylinders	Good
Cylinder Pins and Bushings Condition	Good	Limited Function Check (Hydraulics)	The hydraulic system was operational.

UNDERCARRIAGE

Undercarriage 12 in Triple Grouser Track Shoes w/Rubber Pads	Track Tensioner Condition	No visible damage
Grouser Height Measurement Left Side: 22 mm, Right Side: 23 mm, Rear grouser: 22 mm	Shoe Width	12 in track shoes
	Pins and Bushings Turned?	No

RECONDITIONING

Travel Alarm - Inop	\$200
Limited Function Check (Drivetrain) - Parking Brake Circuit Inop after Initial Testing - Unit Will Not Move	\$500
Limited Function Check (Chassis) - Worn	\$1,500
Hydraulic Tank - Seeping	\$300



Total

\$2,500
